

Case 262 : Narrative

Case Vehicle (A): 2000 Honda
Type: CR-V ES, AWD, 4-door SUV
Driver: 21-year-old female
CDC: 99-0000-0, 02-RDAW-3

SITUATION

1 It was a clear night and the roads were dry and lighted by streetlights as 2 case vehicle (A) was traveling south at an unknown speed on a two-lane asphalt road. 3 The driver apparently fell asleep as the road curved to the left, and case vehicle (A) went straight and 4 exited the west edge of the road surface. 5 6 Case vehicle (A) traveled over a grassy area, and struck and 7 knocked over a street sign with its right-front bumper. After the vehicle struck the sign, the driver woke up and steered left, causing case vehicle (A) to enter a counterclockwise yaw. 8 Case vehicle (A) then crossed a two-lane asphalt road, 9 went across the grassy shoulder, 10 vaulted a creek, and struck the opposite embankment with the right side. The female driver exited the vehicle and went to a nearby home to call a tow truck. She claimed she was alone in the vehicle at the time of the crash, but a right-front passenger was found under the glove-box area covered by the passenger airbag after the vehicle had been removed from the ditch. The right-front passenger was transported by helicopter to a regional hospital and was transferred two days later to a level-one trauma facility, where she was hospitalized for ten days. The driver was transported by ambulance to a regional hospital and was treated and released. Case vehicle (A) was towed due to damage. The driver of case vehicle (A) had been drinking, but the results of the blood test were unavailable.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[11](#) Damage to case vehicle (A) was moderate. [12](#) Direct damage from the frontal impact with the signpost was probably minor, but was masked by the more extensive damage from the right-side impact with the embankment and could not be clearly defined. Direct damage from the side impact began at the right-front bumper corner and extended 330-cm rearward along the right side to just behind the right-rear wheel. [13](#) The maximum crush from the right-side impact was 26 cm to the right fender above the wheel well.

Using the WinSMASH accident-reconstruction program and [14](#) [15](#) [16](#) [17](#) a crush profile measured along the side of case vehicle (A), the following impact severity was calculated for the right-side impact with the embankment:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	26 (16)	-9 (-6)	-25 (-15)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

In the front, [18](#) the right portion of the bumper was crushed rearward and to the left, and the left half of the hood was buckled. The right half of the grille, the hood, and [19](#) the engine compartment were deformed. The hood latch was not damaged and was operational. Both hood hinges were deflected to the left, but not separated. The rear edge of the hood was elevated, but it did not contact the windshield. [20](#) Deformation of the upper portion of the right A-pillar, the roof, and the windshield header damaged and

cracked the far right edge of the windshield. [21](#) Roof deformation caused a small amount of bond separation (less than 5 percent) along the right edge of the roof.

[22](#) [23](#) [24](#) [25](#) On the right side, the fender, the upper and lower sections of the A- and B-pillars, the front and rear doors, the lower section of the C-pillar, the roof siderail, and the quarter panel were crushed inward. [26](#) The roof was buckled to the left and downward. [27](#) The right-front wheel was severely deflected outward. [28](#) Both right-side doors remained closed and the front door was jammed closed, but the rear door was operational. The right-front door window was broken out. The rear door and cargo-area glazing remained intact. The right wheelbase was reduced 7 cm.

[29](#) The left fender was deflected inward, the lower section of the left A-pillar was deformed, and the left-side rearview mirror was torn off. This damage was reportedly caused by towing personnel when the vehicle was pulled out of the ditch. [30](#) Both left-side doors remained closed and operational during the crash. The left-side glazing remained intact and [31](#) the left wheelbase was increased 3 cm.

[32](#) There was no damage to the rear of the vehicle. There was no damage to the backlight.

Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, and [33](#) [34](#) [35](#) both deployed in the right-side impact. [36](#) [37](#) [38](#) [39](#) There was no damage to the flaps/covers of the steering-wheel and passenger airbag modules. [40](#) [41](#) There was no damage to the steering-wheel rim or spokes. [42](#) There was no displacement of the steering column. [43](#) The plastic on the lower section of the vertical console was broken and [44](#) the console was deflected to the right. The driver knee-bolster cover was loosened. The mid and upper sections of the instrument panel were slightly deformed. [45](#) The glove-box area was bowed and pushed rearward. [46](#) The right sunvisor was bent, and the vanity mirror was cracked. [47](#) The right-front door panel was cracked and the right-front door handle was deflected out. [48](#) The right-roof structure, the right-roof headliner, and [49](#) the right-roof siderail were deformed. The upper and lower sections of the right A-pillar and the

lower section of the B-pillar were deformed. The following intrusions were noted and measured.

Location	Component	Distance (cm)	Direction
center front 50 58	vertical console	2	to rear
right front 51	roof	11	down
52	upper A-pillar	8	to rear
53	door at parcel tray (max intrusion)	8	to left
54	B-pillar	7	to left
55	A-pillar	3	to left
	roof siderail	3	to left
	instrument panel	3	to left
56	instrument panel	2	to rear
57	door at contact	2	to left

[58](#) [59](#) There was no other interior damage.

OCCUPANT KINEMATICS AND INJURIES

[60](#) The 5-ft, 5-in, 125-lb, 21-year-old female driver was wearing the three-point belt, [61](#) and the frontal-impact airbag deployed. [62](#) The seatbelt was pulled out and would not retract, [63](#) there were webbing imprints on the plastic D-ring, and [64](#) there were plastic transfer marks on the belt webbing. The driver seat was in a mid-seat track position and the seatback was slightly reclined.

During the impact, the driver moved forward and to the right into the three-point belt restraint. She sustained an abrasion to her chest, probably from loading by the shoulder belt, but possibly from the airbag.

[65](#) The 5-ft, 3-in, 142-lb, 23-year-old female, right-front passenger was **not** wearing the three-point belt, [66](#) but the frontal-impact airbag deployed. The seatbelt was found in a retracted position, and was trapped by the B-pillar. The right-front passenger seat was in the full-rear seat-track position.

At the time of these impacts, the right-front passenger was asleep and her exact position is unknown. On impact with the embankment, she moved primarily to the right and somewhat forward relative to the vehicle interior. Her right hip, right shoulder, and the right side of her chest contacted the right-door interior, [67](#) [68](#) as evidenced by the broken plastic and by the outward bowing of the panel. She sustained a brain contusion to the right parietal cortex, a left frontal brain contusion, lacerations to the right and left cheeks and the right upper lip, and an abrasion to the right side of the forehead, probably due to contact with the right-front side-door window, the right roof siderail, the right B-pillar, or possibly due to contact with the embankment. She sustained fractures to the posterior aspect of the first and second right upper ribs, a contusion to the right side of the chest, a laceration to the dorsal aspect of the right hand, and a contusion and abrasion to the right upper arm, probably due to contact with the upper portion of the right-front door interior. She sustained a fracture to the right transverse process of L5, a comminuted right sacral ala fracture, fractures to the superior and inferior aspects of the right and left pubic rami, and a comminuted fracture to the left pubic bone, probably due to contact with the right-front side-door interior. She sustained lacerations to the anterior and posterior aspects of the right forearm, probably due to broken glass. She sustained an abrasion to the left big toe, probably due to contact with the floor and/or toe pan.

The following tables and attached drawings [69](#) [70](#) summarize the injuries sustained by the two occupants of case vehicle (A).

Occupant: Driver	Age: 21 years	Gender: Female		
Restraints: 3-point belt worn; frontal-impact airbag deployed	Stature: 165 cm (5 ft, 5 in)	Mass: 57 kg (125 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Abrasion, chest	1	—	Shoulder belt	Airbag
Maximum A.I.S. Level	1	—	—	—
Injury Severity Score	1	—	—	—

Occupant: Right-front	Age: 23 years	Gender: Female		
Restraints: 3-point belt <i>not</i> worn; frontal-impact airbag deployed	Stature: 160 cm (5 ft, 3 in)	Mass: 64 kg (142 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Brain contusion, right parietal cortex	3	—	Right-front door window, roof siderail, B-pillar	Ground
Brain contusion, left frontal	3	—	Right-front door window, roof siderail, B-pillar	Ground
Abrasion, right side of the forehead	1	—	Right-front door window, roof siderail, B-pillar	Ground
Lacerations, right and left cheeks, and right upper lip	1	—	Right-front door window, roof siderail, B-pillar	Ground
Contusion and abrasion, right upper arm	1	—	Right-front door interior	—

Fracture, posterior aspects of right upper ribs one and two	2	—	Right-front door interior	—
Contusion, right side of chest	1	—	Right-front door interior	—
Lacerations, anterior and posterior aspects of right forearm	1	—	Broken glass	—
Laceration, dorsal aspect of right hand	1	—	Right-front door interior	—
Fracture, right transverse process of L5	2	—	Right-front door interior	—
Comminuted fracture, left pubic bone	2	—	Right-front door interior	—
Comminuted fracture, right sacral ala	3	—	Right-front door interior	—
Fracture, right superior and inferior pubic rami	2	—	Right-front door interior	—
Fracture, left superior and inferior pubic rami	2	—	Right-front door interior	—
Abrasion, left big toe	1	—	Floor/toe pan	—
Maximum A.I.S. Level	3	—	—	—
Injury Severity Score	22	—	—	—

CASE NO.: 262-01

CASE VEHICLE: 2000 Honda

TYPE: CR-V ES, AWD, 4-door SUV

OCCUPANT: Driver: 21-year-old female

STATURE: 165 cm (5 ft, 5 in) MASS: 57 kg (125 lb)

RESTRAINTS: 3-point belt worn, frontal-impact
airbag deployed

SEVERITY: MAIS - 1 : ISS - 1



CASE NO.: 262-01

CASE VEHICLE: 2000 Honda


TYPE: CR-V ES, AWD, 4-door SUV

OCCUPANT: Right front: 23-year-old female

STATURE: 160 cm (5 ft, 3 in) MASS: 64 kg (142 lb)

RESTRAINTS: 3-point belt not worn, frontal-impact
airbag deployed

SEVERITY: MAIS - 3 : ISS - 22

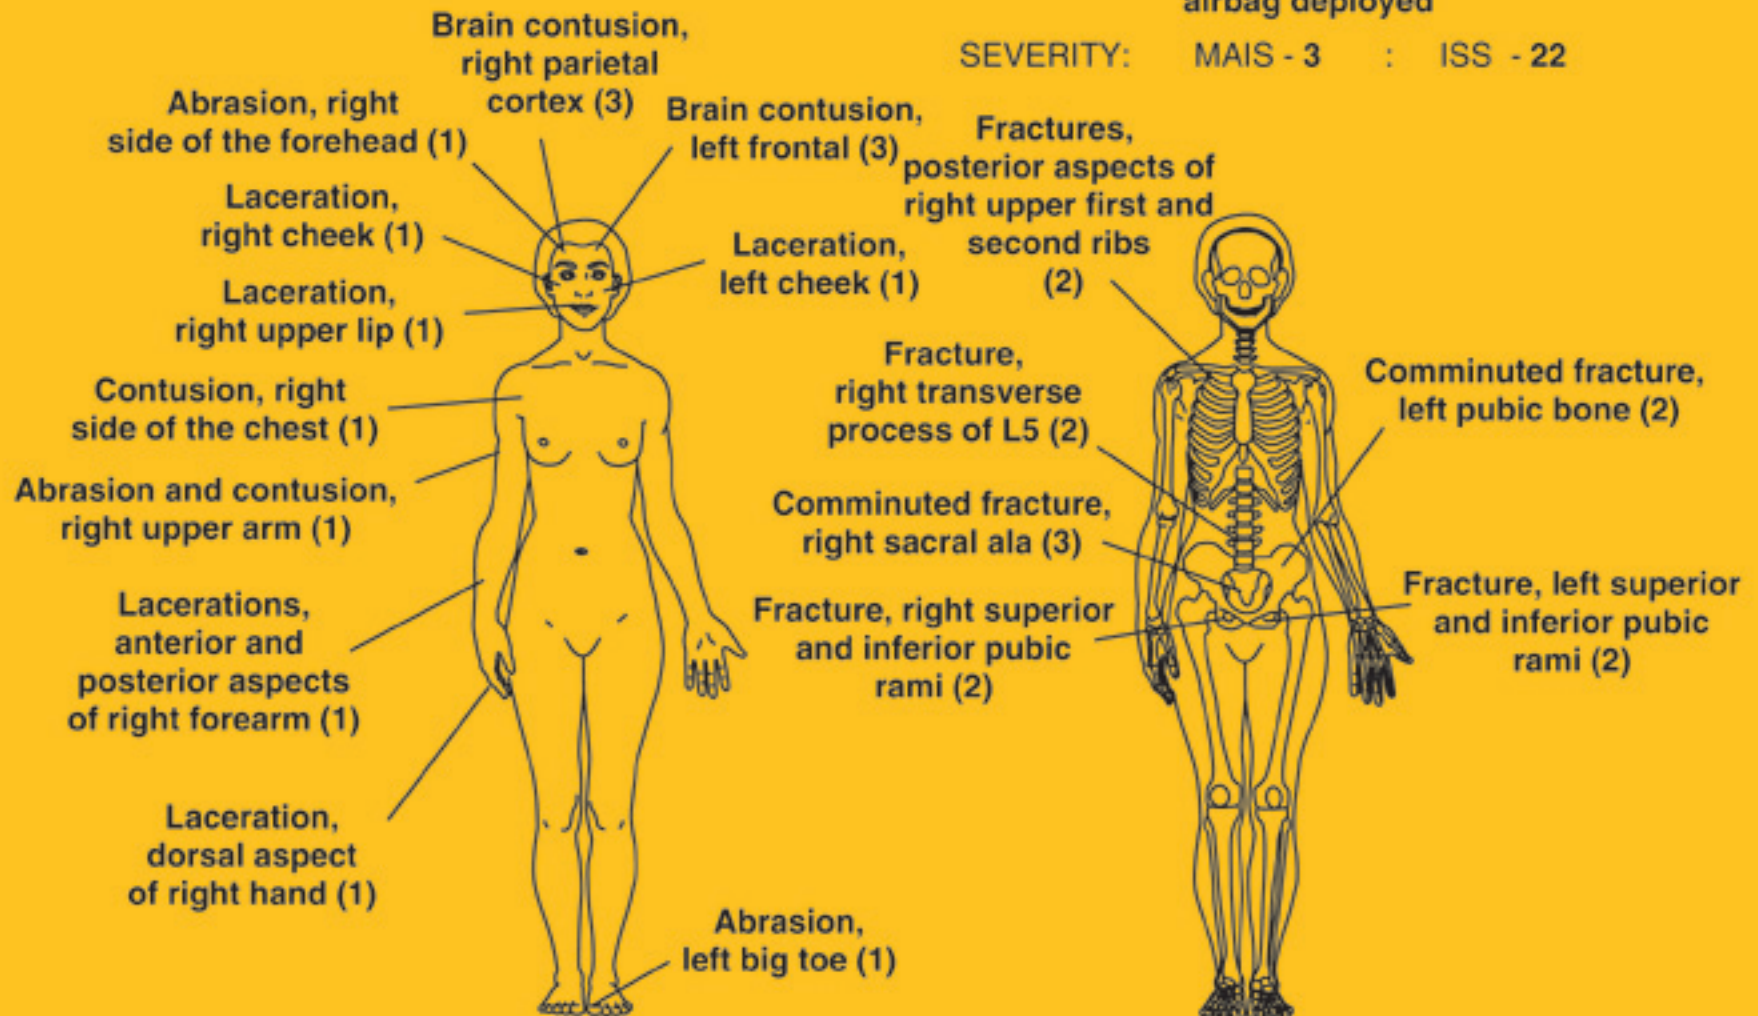

Case No.: 262-01

Case Veh. (A): 2000 Honda

Type: CR-V ES, AWD, 4-door SUV


Driver: 21-year-old female

Light Conditions: **Dark - lighted**

Weather: **Clear**

Road Surface: **Dry**

Road Construction: **Asphalt**

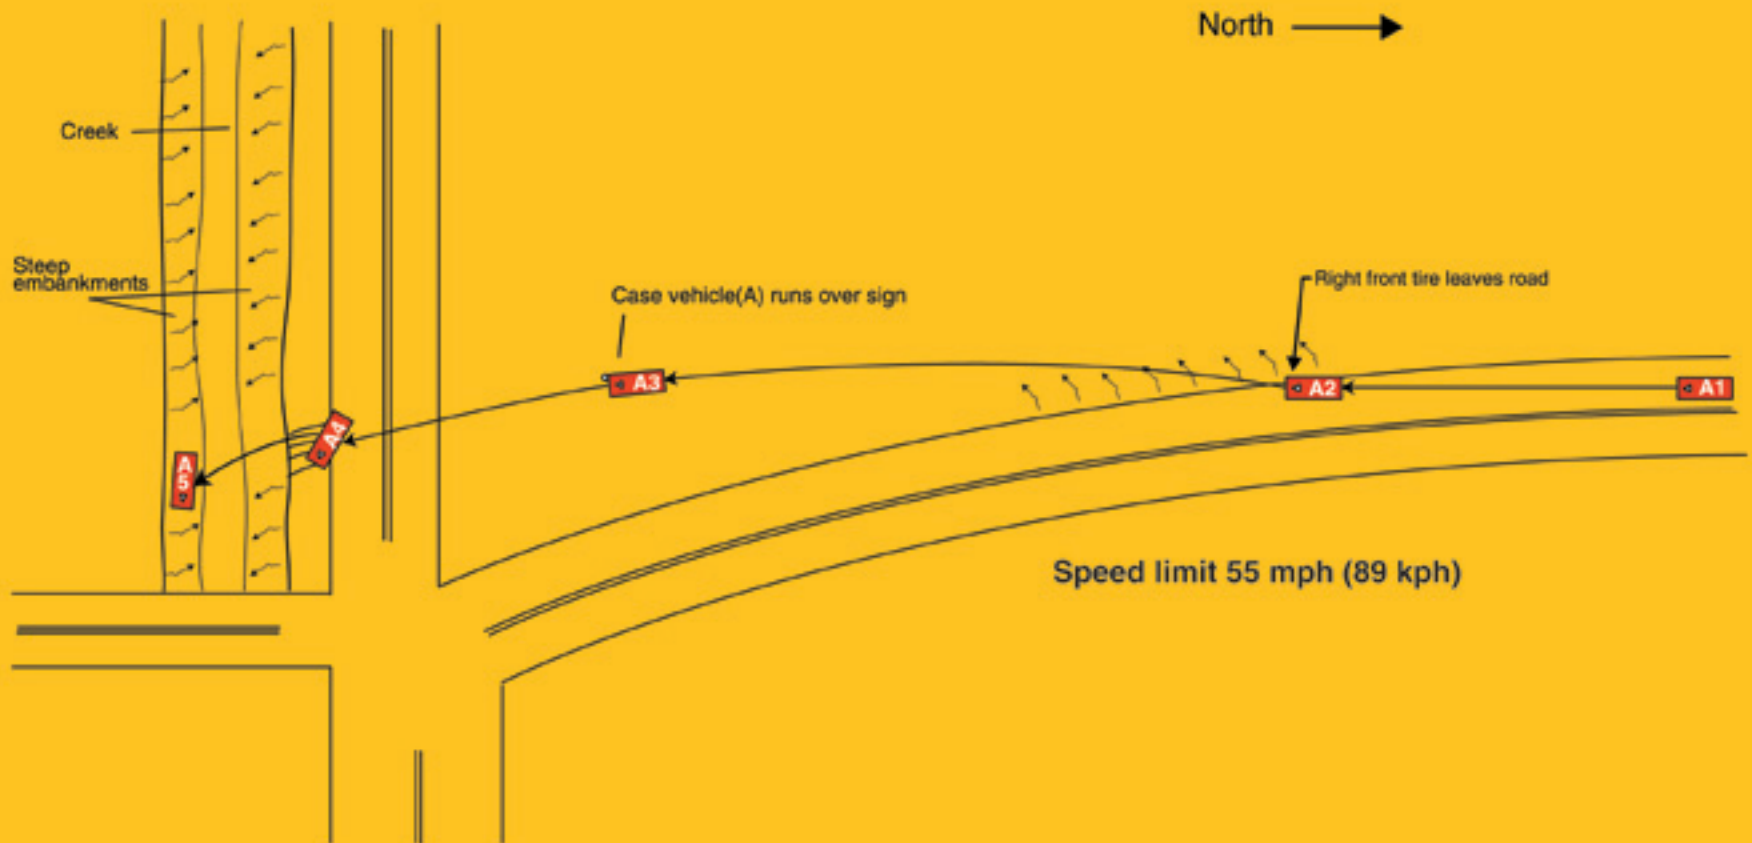

Vehicle Report

General

Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	more
V207 — Limited Access Highway	0	No	more
V208 — Road Total Lanes	2	2 lanes	more
V209 — Intersecting Road Total Lanes	2	2 lanes	more
V210 — Road Surface Type	1	Asphalt	more
V211 — Road Defects	0	No	more
V212 — Construction Zone	0	No	more
V213 — Road Alignment Vertical Plane	1	Level	more
V214 — Road Alignment Horizontal Plane	2	Curve	more
V215 — Surface Covering	10	Dry	more
V216 — Visibility Limitation	0	None	more
V217 — Visibility Obstruction	0	None	more
V218 — Speed Limit	6	86-90 km/h .. 55 mph	more
V219 — Precipitation Type	0	None	more
V220 — Precipitation Rate	8	Not applicable	more
V221 — Temperature	5	6 to 15 C .. 42 to 59 F	more
V222 — Crosswind	1	Light	more
V223 — Light Conditions	5	Dark, unlighted	more
V224 — Mechanical Malfunction Mention	0	No	more
V225 — Case Vehicle and Object	1	Yes	more
V226 — Case Vehicle Rollover	0	No	more
V227 — Case Vehicle Ran Off Roadway	1	Yes	more

V228 — Moving Case Vehicle/Contacted Moving Vehicle	0	No	more
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	more
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	more
V231 — Total Vehicles Hit By Case Vehicle	0	0 vehicles	more
V232 — Any Fire in Crash	0	No	more
V233 — Max Police Severity-PAR	3	A - Incapacitating Injury	more
V234 — Driver Alcohol Involvement	1	Had been drinking	more
V235 — Driver Alcohol BAC	90	Chemical test, no results	more
V236 — Driver Impairment Mention	0	No	more
V237 — Driven/Towed From Scene	2	Towed Due to Damage	more

Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN			more
V303 — Other Vehicle Manufacturer	998	No Other Vehicle	more
V304 — Other Vehicle Body Code	98	No Other Vehicle	more
V305 — Other Vehicle Make/Model	0000	No other vehicle	more
V306 — Other Vehicle Model Year	9999	No other vehicle	more
V307 — Other Vehicle Mass	999998	No other vehicle	more
V308 — Other Vehicle Number	8	No other vehicle	more
V309 — Other Vehicle Number of Occupants	98	No other vehicle	more
V310 — Other Vehicle Traveling Speed	999	Unknown	more
V311 — Highest Police Injury Severity	8	Unoccupied Vehicle	more
V312 — Other Vehicle Type	98	No Other Vehicle	more
V313 — Other Vehicle Wheelbase (cm)	998	No other vehicle	more
V314 — Average Track Width	999	Unknown	more
V315 — Overall Length	999	Unknown	more
V316 — Overall Width (OAW)	999	Unknown	more
V317 — Front Overhang (FOH)	999	Unknown	more
V318 — Rear Overhang (ROH)	999	Unknown	more
V319 — Undeformed End Width (UEW)	999	Unknown	more
V320 — Engine Displacement	9.9 l	—	—
V321 — Engine: Number of Cylinders	99	Unknown	more
V322 — Direct Damage Length (DDL)	999	Unknown	more
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	more
V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	more

Case Vehicle

General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	JHLRD1865YC0	—	—
V402 — Manufacturer/Body Code	88114	—	—
V403 — Vehicle Manufacturer	881	Honda	more
V404 — Vehicle Body Code	14	—	—
V405 — Make/Model Code	2351	—	—
V406 — Model Year	2000	—	—
V407 — Vehicle Mass	001452 kg	—	—
V408 — Odometer Reading	030021 miles	—	—
V409 — Number of Occupants	02	—	—
V410 — Traveling Speed	999	Unknown	more
V411 — Body Type	21	Small utility (e.g. Jeep, Scout, Bronco)	more
V412 — Stolen Vehicle	8	Not currently collected	more
V413 — Body Structure	2	Unitized	more
V414 — Transmission Type	1	Automatic	more
V415 — Transmission Lever Location	3	Column	more
V416 — Steering	1	Power	more
V417 — Brakes	1	Power	more
V418 — Brake Type	2	Disc - front wheels	more
V419 — Brake Anti-lock Device	2	Four-wheel	more
V420 — Air Conditioning in Vehicle	8	Not currently collected	more
V421 — Drive Type	4	All wheel drive	more
V422 — Dual Rear Wheels	0	No	more
V423 — Original Restraint System Type	3	Airbag	more
V424 — Equipped With Roll Bar	0	No	more

V425 — Roof Type	1	Solid	more
V426 — Wheelbase	262 cm	—	—
V427 — Anti-lacerative Glass	0	None	more
V428 — Average Track Width	153 cm	—	—
V429 — Overall Length	440 cm	—	—
V430 — Overall Width (OAW)	175 cm	—	—
V431 — Front Overhang	084 cm	—	—
V432 — Rear Overhang	094 cm	—	—
V433 — Undeformed End Width (UEW)	158 cm	—	—
V434 — Engine Displacement	2.0 <i>l</i>	—	—
V435 — Engine: Number of Cylinders	04	—	—
V436 — Direct Damage Length (DDL)	999	Unknown	more
V437 — Front End Overlap % (FEO)	99	Missing or Not applicable	more
V438 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	more

Case Vehicle

Damage

Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	999	Unknown	more
V502 — Maximum Crush - Right Side	026 cm	—	—
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	more
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	more
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	more
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	more
V507 — Are Events In Chronological Order	1	Yes	more
V508 — Event 1 Impact Location	4	Outside Roadside right-of-way	more
V509 — Event 1 Impact Configuration	17	FRONT of case veh - object	more
V510 — Event 1 Object/Vehicle Contacted	77	Sign post, utility pole, tree	more
V511 — Event 2 Impact Location	4	Outside Roadside right-of-way	more
V512 — Event 2 Impact Configuration	47	RIGHT of case veh - object	more
V513 — Event 2 Object/Vehicle Contacted	78	Ditch	more
V514 — Event 3 Impact Location	8	No 3rd event	more
V515 — Event 3 Impact Configuration	88	No 3rd event	more
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V517 — Event 4 Impact Location	8	No 4th event	more
V518 — Event 4 Impact Configuration	88	No 4th event	more
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V520 — Event 5 Impact Location	8	No 5th event	more
V521 — Event 5 Impact Configuration	88	No 5th event	more

V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V523 — Event 6 Impact Location	8	No 6th event	more
V524 — Event 6 Impact Configuration	88	No 6th event	more
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V526 — Event 7 Impact On Road	8	No 7th event	more
V527 — Event 7 Impact Configuration	88	No 7th event	more
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V529 — Primary CDC Case Vehicle -event Number	2	Event 2	more
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	more
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	more
V532 — Primary CDC Case Vehicle -crush	026	—	—
V533 — Primary CDC Case Vehicle -clock #1	02	2 o'clock	more
V534 — Primary CDC Case Vehicle letter 1 #1	18	R - Right Side	more
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	more
V536 — Primary CDC Case Vehicle letter 3 #1	01	A - All	more
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	more
V538 — Primary CDC Case Vehicle Extent #1	03	Extent 3	more
V539 — Primary CDC Case Vehicle -CDC #1	02RDAW3	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more

V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more
V548 — Primary CDC Contacted Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V549 — Primary CDC Contacted Vehicle - crush	998	Not Applicable	more
V550 — Primary CDC Contacted Vehicle - clock #1	98	Not Applicable	more
V551 — Primary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V552 — Primary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V553 — Primary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V554 — Primary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V555 — Primary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V556 — Primary CDC Contacted Vehicle - CDC #1	9800000	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V563 — Primary CDC Contacted Vehicle - CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	1	Event 1	more
V565 — Secondary CDC Case Vehicle - Impact Speed	999	Unknown	more
V566 — Secondary CDC Case Vehicle - Estimated By	1	—	—

V567 — Secondary CDC Case Vehicle -crush	999	Unknown	more
V568 — Secondary CDC Case Vehicle -clock #1	99	Unknown or no damage	more
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	more
V574 — Secondary CDC Case Vehicle -CDC #1	9900000	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V581 — Secondary CDC Case Vehicle -CDC #2	9900000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more
V583 — Secondary CDC Contacted Vehicle - Estimated By	1	—	—
V584 — Secondary CDC Contacted Vehicle - crush	999	Unknown	more
V585 — Secondary CDC Contacted Vehicle - clock #1	99	Unknown or no damage	more
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V588 — Secondary CDC Contacted Vehicle	00	Missing Data/Not	more

letter 3 #1		applicable	
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V591 — Secondary CDC Contacted Vehicle - CDC #1	9900000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V598 — Secondary CDC Contacted Vehicle - CDC #2	9900000	—	—

Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	2	—	—
V602 — Primary Impact Total Delta-V	026 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-009 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	-025 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0047 kJ	—	—
V606 — Primary Impact Case Vehicle - reconstruction	22	Reconstructed, moderate confidence level	more
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V612 — Case Vehicle Secondary Impact Number	1	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	999	Unknown	more
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	9999	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	9999	—	—
V617 — Secondary Case Vehicle Reconstruction Note	10	Other	more
V618 — Secondary Case Vehicle Reconstruction Mode	5	Not reconstructed	more

V619 — Secondary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	2	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	026 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-009 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	-025 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0047 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	more
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V630 — Primary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V634 — Case Vehicle Secondary Impact Number	1	—	—
V635 — Secondary Case Vehicle Reconstruction Total EBS	999	Unknown	more
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	9999	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	9999	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	9999	—	—
V639 — Secondary Case Vehicle	10	Other	more

Reconstruction Note			
V640 — Secondary Case Vehicle Reconstruction Mode	5	Not reconstructed	more
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	5	Other	more
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	999	Unknown	more
V648 — Case Vehicle Impact 1 Max Crush	999	Unknown	more
V649 — Case Vehicle Impact 1 Field-L	999	Unknown	more
V650 — Case Vehicle Impact 1 C1	999	Unknown	more
V651 — Case Vehicle Impact 1 C2	999	Unknown	more
V652 — Case Vehicle Impact 1 C3	999	Unknown	more
V653 — Case Vehicle Impact 1 C4	999	Unknown	more
V654 — Case Vehicle Impact 1 C5	999	Unknown	more
V655 — Case Vehicle Impact 1 C6	999	Unknown	more
V656 — Case Vehicle Impact 1 +/- D	9999	—	—
V657 — Case Vehicle Reconstructed Impact Number	2	—	—
V658 — Case Vehicle Impact 2 Plane	4	Above sill	more
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	330 cm	—	—
V660 — Case Vehicle Impact 2 Max Crush	026 cm	—	—
V661 — Case Vehicle Impact 2 Field-L	330 cm	—	—
V662 — Case Vehicle Impact 2 C1	005 cm	—	—
V663 — Case Vehicle Impact 2 C2	005 cm	—	—
V664 — Case Vehicle Impact 2 C3	008 cm	—	—

V665 — Case Vehicle Impact 2 C4	014 cm	—	—
V666 — Case Vehicle Impact 2 C5	022 cm	—	—
V667 — Case Vehicle Impact 2 C6	026 cm	—	—
V668 — Case Vehicle Impact 2 +/- D	-020 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	9	Unknown	more
V670 — Other Vehicle Impact 1 Plane	9	Unknown	more
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	999	Unknown	more
V672 — Other Vehicle Impact 1 Max Crush	999	Unknown	more
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	more
V674 — Other Vehicle Impact 1 C1	999	Unknown	more
V675 — Other Vehicle Impact 1 C2	999	Unknown	more
V676 — Other Vehicle Impact 1 C3	999	Unknown	more
V677 — Other Vehicle Impact 1 C4	999	Unknown	more
V678 — Other Vehicle Impact 1 C5	999	Unknown	more
V679 — Other Vehicle Impact 1 C6	999	Unknown	more
V680 — Other Vehicle Impact 1 +/- D	9999	—	—
V681 — Other Vehicle Reconstructed Impact Number	9	Unknown	more
V682 — Other Vehicle Impact 2 Plane	9	Unknown	more
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	more
V684 — Other Vehicle Impact 2 Max Crush	999	Unknown	more
V685 — Other Vehicle Impact 2 Field-L	999	Unknown	more
V686 — Other Vehicle Impact 2 C1	999	Unknown	more
V687 — Other Vehicle Impact 2 C2	999	Unknown	more
V688 — Other Vehicle Impact 2 C3	999	Unknown	more
V689 — Other Vehicle Impact 2 C4	999	Unknown	more
V690 — Other Vehicle Impact 2 C5	999	Unknown	more
V691 — Other Vehicle Impact 2 C6	999	Unknown	more
V692 — Other Vehicle Impact 2 +/- D	9999	—	—

Case Vehicle

Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	0	No	more
V702 — Right Front Wheel Damaged	1	Yes	more
V703 — Right Rear Wheel Damaged	0	No	more
V704 — Left Rear Wheel Damaged	0	No	more
V705 — Left Front Tire Tread Type	4	All Weather	more
V706 — Right Front Tire Tread Type	4	All Weather	more
V707 — Right Rear Tire Tread Type	4	All Weather	more
V708 — Left Rear Tire Tread Type	4	All Weather	more
V709 — Left Front Carcass Construction	3	Radial	more
V710 — Right Front Carcass Construction	3	Radial	more
V711 — Right Rear Carcass Construction	3	Radial	more
V712 — Left Rear Carcass Construction	3	Radial	more
V717 — Left Front Tire Size	P20570R15	—	—
V718 — Right Front Tire Size	P20570R15	—	—
V719 — Right Rear Tire Size	P20570R15	—	—
V720 — Left Rear Tire Size	P20570R15	—	—

Case Vehicle

Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	more
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	more
V803 — Main Filler Cap Location	113	Left of frame laterally - above vertically	more
V804 — Main Tank Material	1	Steel	more
V805 — Aux Tank Type	8	Not applicable (not equipped)	more
V806 — Aux Tank Location	888	Not applicable (not equipped)	more
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	more
V808 — Aux Tank Material	8	Not applicable	more
V901 — Fuel Leakage From Crash	0	No	more
V1001 — Fire In Or On Case Vehicle	0	No	more

Case Vehicle

Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	more
V1102 — Hood Latch Damaged	0	No	more
V1103 — Hood Latch Jammed	8	Not applicable	more
V1104 — Left Hood Hinge Damaged	1	Yes	more
V1105 — Left Hood Hinge Separated	0	No	more
V1106 — Right Hood Hinge Damaged	1	Yes	more
V1107 — Right Hood Hinge Separated	0	No	more
V1108 — Hood Remained On Vehicle	1	Yes	more
V1109 — Rear Hood Edge Elevated	1	Yes	more
V1110 — Edge Contacted Windshield	0	No	more
V1111 — Edge Penetrated Windshield	8	Not applicable	more
V1112 — Hood Latch Location	1	Front of Vehicle	more
V1113 — Eng/Transmissn Mount Separation	0	No	more
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	more
V1115 — Steerng Column Coupling Damaged	9	Unknown	more
V1116 — Steerng Column Coupling Separated	9	Unknown	more
V1117 — Eng Comp Telescopng Unit	88	Not collected	more
V1118 — Comp Orig/Telescopd Diff	888	Not collected	more
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	more
V1120 — Upper Left A-pillar Separation	0	No	more
V1121 — Lower Left A-pillar Separation	4	No separation, but damaged	more
V1122 — Upper Left B-pillar Separation	0	No	more
V1123 — Lower Left B-pillar Separation	0	No	more

V1124 — Upper Left C-pillar Separation	0	No	more
V1125 — Lower Left C-pillar Separation	0	No	more
V1126 — Upper Left D-pillar Separation	0	No	more
V1127 — Lower Left D-pillar Separation	0	No	more
V1128 — Left Front Door Opening Cause	0	Door did not open	more
V1129 — Left Rear Door Opening Cause	0	Door did not open	more
V1130 — Left Front Door Jammed Closed	0	No	more
V1131 — Left Rear Door Jammed Closed	0	No	more
V1132 — Rear Door Type	5	Single door	more
V1133 — Rear Door Opening Cause	0	Door did not open	more
V1134 — Rear Door Jammed Closed	0	No	more
V1135 — Luggage Partition Damagd	8	Not applicable	more
V1136 — Spare Tire Status	8	Not collected	more
V1137 — Trailer Hitch Type	0	No hitch	more
V1138 — Trailer Type	0	No trailer	more
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	more
V1140 — Upper Right A-pillar Separation	4	No separation, but damaged	more
V1141 — Lower Right A-pillar Separation	4	No separation, but damaged	more
V1142 — Upper Right B-pillar Separation	4	No separation, but damaged	more
V1143 — Lower Right B-pillar Separation	4	No separation, but damaged	more
V1144 — Upper Right C-pillar Separation	0	No	more
V1145 — Lower Right C-pillar Separation	4	No separation, but damaged	more
V1146 — Upper Right D-pillar Separation	0	No	more
V1147 — Lower Right D-pillar Separation	0	No	more
V1148 — Right Front Door Opening Cause	00	Door did not open	more
V1149 — Right Rear Door Opening Cause	00	Door did not open	more
V1150 — Right Front Door Jammed Closed	1	Yes	more
V1151 — Right Rear Door Jammed Closed	0	No	more
V1152 — Van Rear Door Type	8	Not applicable (not a van)	more

V1153 — Windshield Cracked		Yes	more
V1154 — Windshield Broken	0	No	more
V1155 — Windshield Cracked or Broken by Occupant	0	No	more
V1156 — Bond Separation Extent	1	1 - 20%	more
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	more

Case Vehicle

Steering

Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	0	None	more
V1202 — Number of Steering Wheel Spokes	4	4 spokes	more
V1203 — Steering Wheel Spoke Damage	0	None	more
V1204 — Column Tilt Feature	2	Up	more
V1205 — Column Swing-away Feature	0	Not equipped	more
V1206 — Column Telescoping Feature	0	Not equipped	more
V1207 — Wheel Energy Absorb Device	8	Not collected	more
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	more
V1209 — Column Energy Absorb Device	88	Not collected	more
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	more
V1211 — Shear Capsule Separation	888	Not collected	more
V1212 — Column Vertical Rotation	0	No apparent rotation	more
V1213 — Column Lateral Rotation	0	No apparent rotation	more
V1214 — Steering Wheel Hub Damage	0	None	more

Case Vehicle

Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	more
V1302 — Was Intrusion Catastrophic	0	No	more
V1303 — Intrusion Number 01	01	Intrusion #1	more
V1304 — Intrusion 01 Occupant Space Number	12	First row, Center seat	more
V1305 — Intrusion 01 Intruding Object	24	Console	more
V1306 — Intrusion 01 Assoc Event Number	2	Event #2	more
V1307 — Intrusion 01 Max Intrusion X-axis	02 cm	—	—
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	more
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	more
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	more
V1313 — Intrusion 01 Injury Number	00	No injury or no intrusion	more
V1314 — Intrusion Number 02	02	Intrusion #2	more
V1315 — Intrusion 02 Occupant Space Number	13	First row, Right seat	more
V1316 — Intrusion 02 Intruding Object	15	Roof or convertible top	more
V1317 — Intrusion 02 Assoc Event Number	2	Event #2	more
V1318 — Intrusion 02 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more

V1320 — Intrusion 02 Max Intrusion Z-axis	11 cm	—	—
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	more
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	more
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	more
V1324 — Intrusion 02 Injury Number	00	No injury or no intrusion	more
V1325 — Intrusion Number 03	03	Intrusion #3	more
V1326 — Intrusion 03 Occupant Space Number	13	First row, Right seat	more
V1327 — Intrusion 03 Intruding Object	09	Door panel or side panel	more
V1328 — Intrusion 03 Assoc Event Number	2	Event #2	more
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1330 — Intrusion 03 Max Intrusion Y-axis	08 cm	—	—
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1332 — Intrusion 03 Occupant Number	02	Occupant number 2, contact	more
V1333 — Intrusion 03 Injury Number	18	—	—
V1334 — Intrusion 03 Occupant Number	02	Occupant number 2, contact	more
V1335 — Intrusion 03 Injury Number	19	—	—
V1336 — Intrusion Number 04	04	Intrusion #4	more
V1337 — Intrusion 04 Occupant Space Number	13	First row, Right seat	more
V1338 — Intrusion 04 Intruding Object	08	A-pillar	more
V1339 — Intrusion 04 Assoc Event Number	2	Event #2	more
V1340 — Intrusion 04 Max Intrusion X-axis	08 cm	—	—
V1341 — Intrusion 04 Max Intrusion Y-axis	03 cm	—	—
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more

V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1346 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1347 — Intrusion Number 05	05	Intrusion #5	more
V1348 — Intrusion 05 Occupant Space Number	13	First row, Right seat	more
V1349 — Intrusion 05 Intruding Object	11	B-pillar	more
V1350 — Intrusion 05 Assoc Event Number	2	Event #2	more
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1352 — Intrusion 05 Max Intrusion Y-axis	07 cm	—	—
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1354 — Intrusion 05 Occupant Number	02	Occupant number 2, contact	more
V1355 — Intrusion 05 Injury Number	01	Injury #1	more
V1356 — Intrusion 05 Occupant Number	02	Occupant number 2, contact	more
V1357 — Intrusion 05 Injury Number	01	Injury #1	more
V1358 — Intrusion Number 06	06	Intrusion #6	more
V1359 — Intrusion 06 Occupant Space Number	13	First row, Right seat	more
V1360 — Intrusion 06 Intruding Object	01	Instrument panel	more
V1361 — Intrusion 06 Assoc Event Number	2	Event #2	more
V1362 — Intrusion 06 Max Intrusion X-axis	02 cm	—	—
V1363 — Intrusion 06 Max Intrusion Y-axis	03 cm	—	—
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more

V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1368 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1369 — Intrusion Number 07	07	Intrusion #7	more
V1370 — Intrusion 07 Occupant Space Number	13	First row, Right seat	more
V1371 — Intrusion 07 Intruding Object	14	Roof side rails	more
V1372 — Intrusion 07 Assoc Event Number	2	Event #2	more
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1374 — Intrusion 07 Max Intrusion Y-axis	03 cm	—	—
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1376 — Intrusion 07 Occupant Number	02	Occupant number 2, contact	more
V1377 — Intrusion 07 Injury Number	01	Injury #1	more
V1378 — Intrusion 07 Occupant Number	02	Occupant number 2, contact	more
V1379 — Intrusion 07 Injury Number	02	Injury #2	more
V1380 — Intrusion Number 08	08	Intrusion #8	more
V1381 — Intrusion 08 Occupant Space Number	13	First row, Right seat	more
V1382 — Intrusion 08 Intruding Object	09	Door panel or side panel	more
V1383 — Intrusion 08 Assoc Event Number	2	Event #2	more
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1385 — Intrusion 08 Max Intrusion Y-axis	02 cm	—	—
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1387 — Intrusion 08 Occupant Number	02	Occupant number 2, contact	more
V1388 — Intrusion 08 Injury Number	16	—	—

V1389 — Intrusion 08 Occupant Number	02	Occupant number 2, contact	more
V1390 — Intrusion 08 Injury Number	17	—	—
V1391 — Intrusion Number 09	00	No Intrusion, None	more
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	more
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	more
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	more
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	more
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	more
V1402 — Intrusion Number 10	00	No Intrusion, None	more
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	more
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	more
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	more
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	more
V1411 — Intrusion 10 Occupant	00	No contact or no intrusion	more

Number			
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	more
V1413 — Door Intrusion Number 01	03	—	—
V1414 — Door Intrusion Number 01 Cause	1	Direct impact	more
V1415 — Door Intrusion Number 02	08	—	—
V1416 — Door Intrusion Number 02 Cause	1	Direct impact	more
V1417 — Door Intrusion Number 03	88	Not Applicable	more
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	more
V1419 — Door Intrusion 01 Component	88	Not Applicable	more
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	more
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	more
V1422 — Door Intrusion 02 Component	88	Not Applicable	more
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	more
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	more
V1425 — Door Intrusion 03 Component	88	Not Applicable	more
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	more
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	more
V1428 — Door Intrusion 04 Component	88	Not Applicable	more
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	more
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	more

Case Vehicle

Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	more
V1502 — Driver Airbag Deployed	1	Yes	more
V1503 — Driver Airbag Condition	0	No Damage	more
V1504 — Passenger Airbag Equip	1	Yes	more
V1505 — Passenger Airbag Deployed	1	Yes	more
V1506 — Passenger Airbag Condition	0	No Damage	more
V1507 — Steering Wheel Airbag Tether	1	Yes	more
V1508 — Driver Airbag Marked By Contact	0	No	more
V1509 — Passenger Airbag Tether	0	No	more
V1510 — Passenger Airbag Marked By Contact	1	Yes	more

Case Vehicle

Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	0	No	more
V1602 — Right Front Door Damaged	4	Yes, occupant contact	more
V1603 — Left Front Hardware Damaged	0	No	more
V1604 — Right Front Hardware Damaged	1	Yes	more
V1605 — Left Front Armrest Damaged	0	No	more
V1606 — Right Front Armrest Damaged	4	Yes, occupant contact	more
V1607 — Left Front Glass Damaged	0	No	more
V1608 — Right Front Glass Damaged	4	Yes, occupant contact	more
V1609 — Left Rear Door Area Damaged	0	No	more
V1610 — Right Rear Door Area Damaged	0	No	more
V1611 — Left Rear Hardware Damaged	0	No	more
V1612 — Right Rear Hardware Damaged	0	No	more
V1613 — Left Rear Armrest Damaged	0	No	more
V1614 — Right Rear Armrest Damaged	0	No	more
V1615 — Left Rear Glass Damaged	0	No	more
V1616 — Right Rear Glass Damaged	0	No	more
V1617 — Left Roof Side Rail Damaged	0	No	more
V1618 — Right Roof Side Rail Damaged	1	Yes	more
V1619 — Left B-pillar Damaged	0	No	more
V1620 — Right B-pillar Damaged	1	Yes	more
V1621 — Left C-pillar Damaged	0	No	more
V1622 — Right C-pillar Damaged	0	No	more
V1623 — Left D-pillar Damaged	0	No	more
V1624 — Right D-pillar Damaged	0	No	more
V1625 — Left Headlining Damaged	1	Yes	more

V1626 — Right Headlining Damaged	1	Yes	more
V1627 — Left Roof Structure Damaged	0	No	more
V1628 — Right Roof Structure Damaged	1	Yes	more
V1629 — Left T/Sun Roof Damaged	8	Not applicable	more
V1630 — Right T/Sun Roof Damaged	8	Not applicable	more
V1631 — Other Left Side Item Damagd	8	Not applicable	more
V1632 — Other Right Side Item Damagd	8	Not applicable	more
V1633 — Foot Controls Damaged	0	No	more
V1634 — Ignition Key Damaged	0	No	more
V1635 — Rear View Mirror Damaged	0	No	more
V1636 — Sunvisor/Fitting Damaged	6	Right side only	more
V1637 — Windshield Molding Damaged	1	Yes	more
V1638 — Left A-pillar Damaged	0	No	more
V1639 — Right A-pillar Damaged	1	Yes	more
V1640 — Center Console Damaged	0	No	more
V1641 — Transmission Lever Damaged	0	No	more
V1642 — Horn/Spoke Shroud Damagd	0	No	more
V1643 — Upper Panel Damaged	1	Yes	more
V1644 — Mid Panel Damaged	1	Yes	more
V1645 — Lower Panel Damaged	1	Yes	more
V1646 — Ashtray Damaged	0	No	more
V1647 — Control Knob/Lever Damaged	0	No	more
V1648 — Glove Compartment Area Damaged	4	Yes, occupant contact	more
V1649 — Instruments Damaged	0	No	more
V1650 — Park Brake Release Damaged	0	No	more
V1651 — Park Brake Pedal Damaged	8	Not applicable	more
V1652 — A/C Or Upper Vent Damaged	1	Yes	more
V1653 — Heater Or A/C Duct Damaged	0	No	more
V1654 — Radio Damaged	0	No	more

V1655 — Other Item Damaged	8	Not applicable	more
V1656 — Rear Window Damaged	0	No	more
V1657 — Rear Window Header Damaged	0	No	more
V1658 — Vertical Console Damaged	4	Yes, occupant contact	more
V1659 — Roof Console Damaged	8	Not applicable	more

Case Vehicle



Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	more
V1702 — Passenger Front Seat Type	05	Bucket	more
V1703 — Driver Seat Mount Type	1	Standard	more
V1704 — Passenger Seat Mount Type	1	Standard	more
V1705 — Driver Swivel Mechanism Equipped	0	No	more
V1706 — Passenger Swivel Mechanism Equipped	0	No	more
V1707 — Driver Seat Original Equipment	1	Yes	more
V1708 — Passenger Seat Original Equipment	1	Yes	more
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	more
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	more
V1711 — Driver Seat Damage	0	None	more
V1712 — Passenger Seat Damage	0	None	more
V1713 — Center Front Armrest Damaged	0	No	more
V1714 — Driver Seat Rotation	0	None apparent	more
V1715 — Passenger Seat Rotation	0	None apparent	more
V1716 — Driver Seat-back Type	3	Reclining	more
V1717 — Passenger Seat-back Type	3	Reclining	more
V1718 — Driver Seat-back Lock Type	1	Manual	more
V1719 — Passenger Seat-back Lock Type	1	Manual	more
V1720 — Driver Seat-back Lock Held	1	Yes	more
V1721 — Passenger Seat-back Lock Held	1	Yes	more
V1722 — Driver Recliner Mechanism Held	1	Yes	more
V1723 — Passenger Recliner Mechanism Held	1	Yes	more


V1724 — Driver Head Restraint Type	1	Adjustable	more
V1725 — Passenger Head Restraint Type	1	Adjustable	more
V1726 — Driver Head Rest Removed	0	No	more
V1727 — Passenger Head Rest Removed	0	No	more
V1728 — Driver Head Rest Adjustment	1	Up	more
V1729 — Passenger Head Rest Adjustment	1	Up	more
V1730 — Driver Head Rest Damage	0	None	more
V1731 — Passenger Head Rest Damage	0	None	more
V1732 — Driver Seat Adjustment Type	1	Manual	more
V1733 — Passenger Seat Adjustment Type	1	Manual	more
V1734 — Driver Seat Adjustment Provided	1	2-way	more
V1735 — Passenger Seat Adjustment Provided	1	2-way	more
V1736 — Driver Seat Adjuster Damage	0	None	more
V1737 — Passenger Seat Adjuster Damage	0	None	more
V1738 — Driver Seat Adjuster Separation	8	Not applicable	more
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	more
V1740 — Driver Seat Pre-crash Position	2	Middle	more
V1741 — Passenger Seat Pre-crash Position	3	Rearward	more
V1742 — Left Rear Seat Type	2	Folding	more
V1743 — Right Rear Seat Type	2	Folding	more
V1744 — Left Rear Seat Damaged	0	None	more
V1745 — Right Rear Seat Damaged	0	None	more
V1746 — Center Rear Armrest Damaged	0	No	more
V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	more
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	more
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	more
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	more

V1751 — Left Rear Seat-back Right Lock Equipped	0	No	more
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	more
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	more
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	more
V1755 — Left 3rd Seat Equipped	0	No	more
V1756 — Right 3rd Seat Equipped	0	No	more
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	more
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	more
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	more
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	more
V1761 — Rear Head Restraints	1	Equipped	more

MEASUREMENTS IN CENTIMETERS

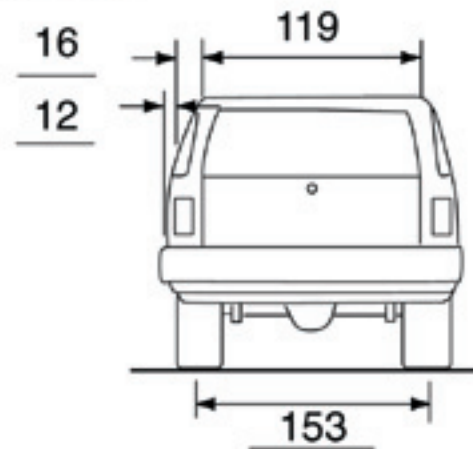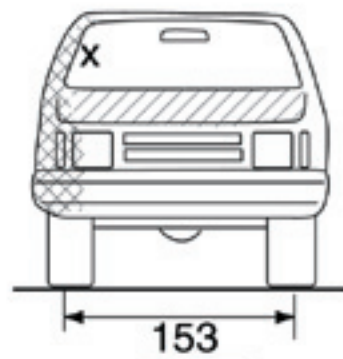


Damaged when towing vehicle out of ditch

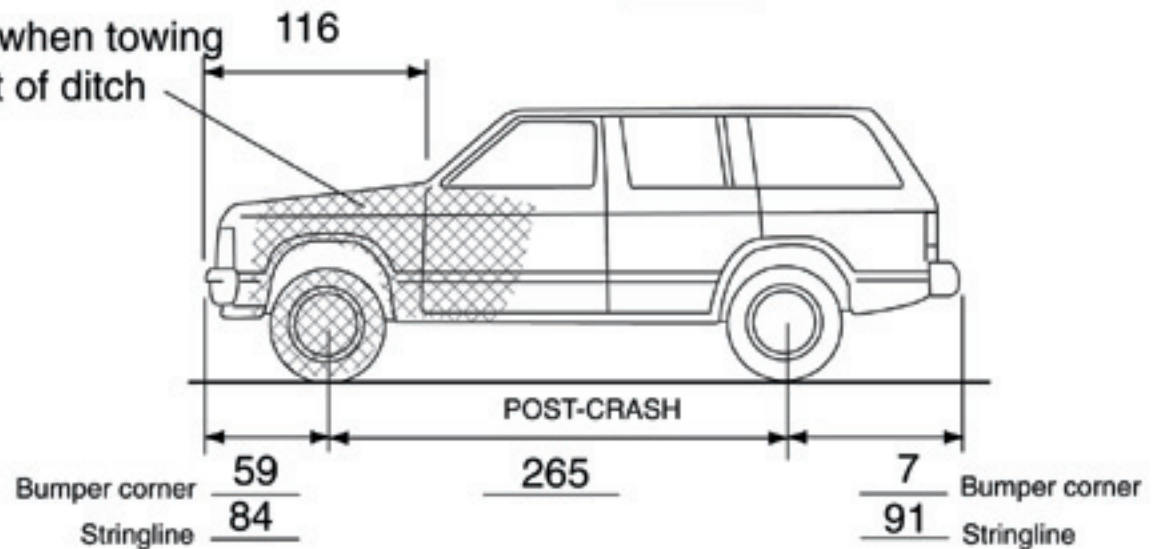

26

Max. crush to
right side at front
fender

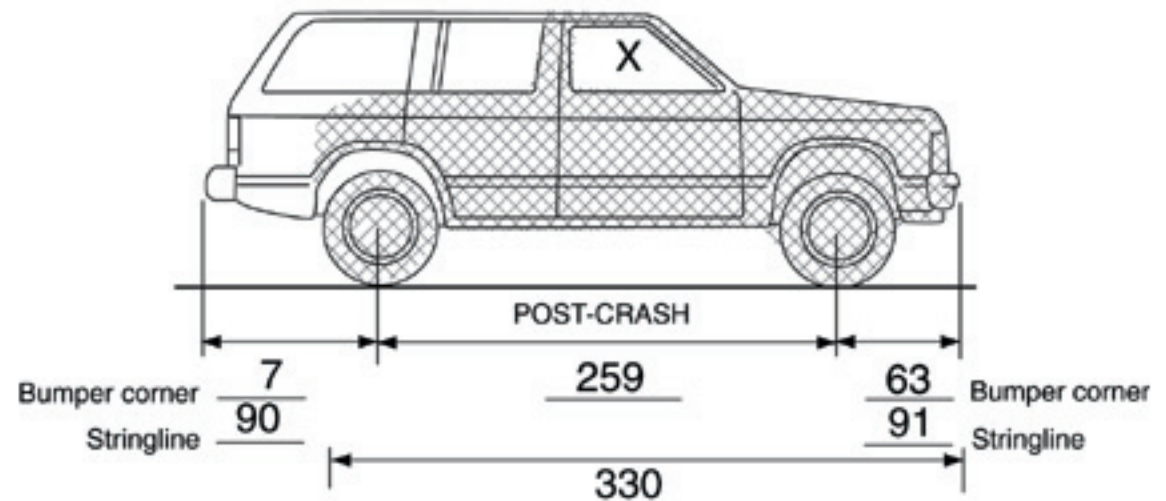

Length fo direct damage to right side

WINDSHIELD MARK ON CASE VEHICLE:


 **HONDA** 
LAMISAFE

AP TECH

M314 AS3

 **E 6**

DOT-376
43R-008008

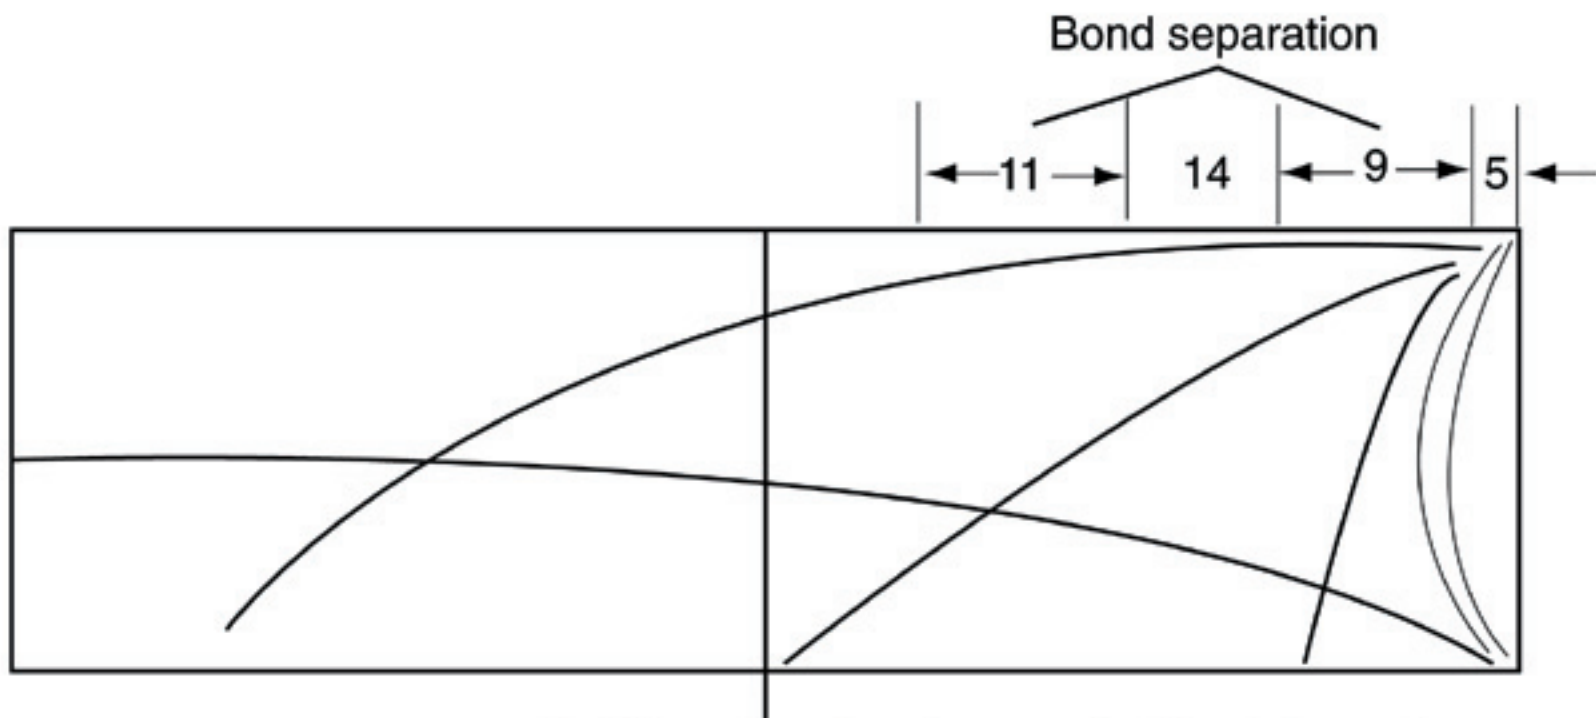

cracked due to roof and upper A-pillar deformation

1 = Definitely 2 = Probably 3 = Possible

INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)					Dominant Crush Direction
		Comparison Value	–	Intruded Value	=	Intrusion	
12	Vertical console	114	–	112	=	2	X
13	Roof	123	–	112	=	11	Z
13	Roof siderail	113	–	110	=	3	Y
13	Door at contact	142	–	140	=	2	Y
13	Door max. at parcel tray	148	–	140	=	8	Y
13	Upper A-pillar	112	–	109	=	3	Y
13	Instrument panel	147	–	144	=	3	Y
13	Upper A-pillar	53	–	45	=	8	X
13	Instrument panel	70	–	68	=	2	X
13	B-pillar	138	–	131	=	7	Y


OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Right front door interior panel	RF	Head	Bent outward	1
B	Right front door interior hardware	RF	Rt. hip	broken plastic	1
C	Vertical console	DR	Rt. leg	Broken plastic	1
D	Right front sunvisor	RF	Head	Vanity mirror broken, possible scuffmark	3
E	Right upper A-pillar	RF	Head	possible scuffmark	3
F	Airbag	RF	Head	possible scuffmark	2
G					

**D = right front sunvisor,
mirror broken, possible
scuffmark**

**E = right upper A-pillar,
possible scuffmark**

**F = airbag,
possible scuffmark**

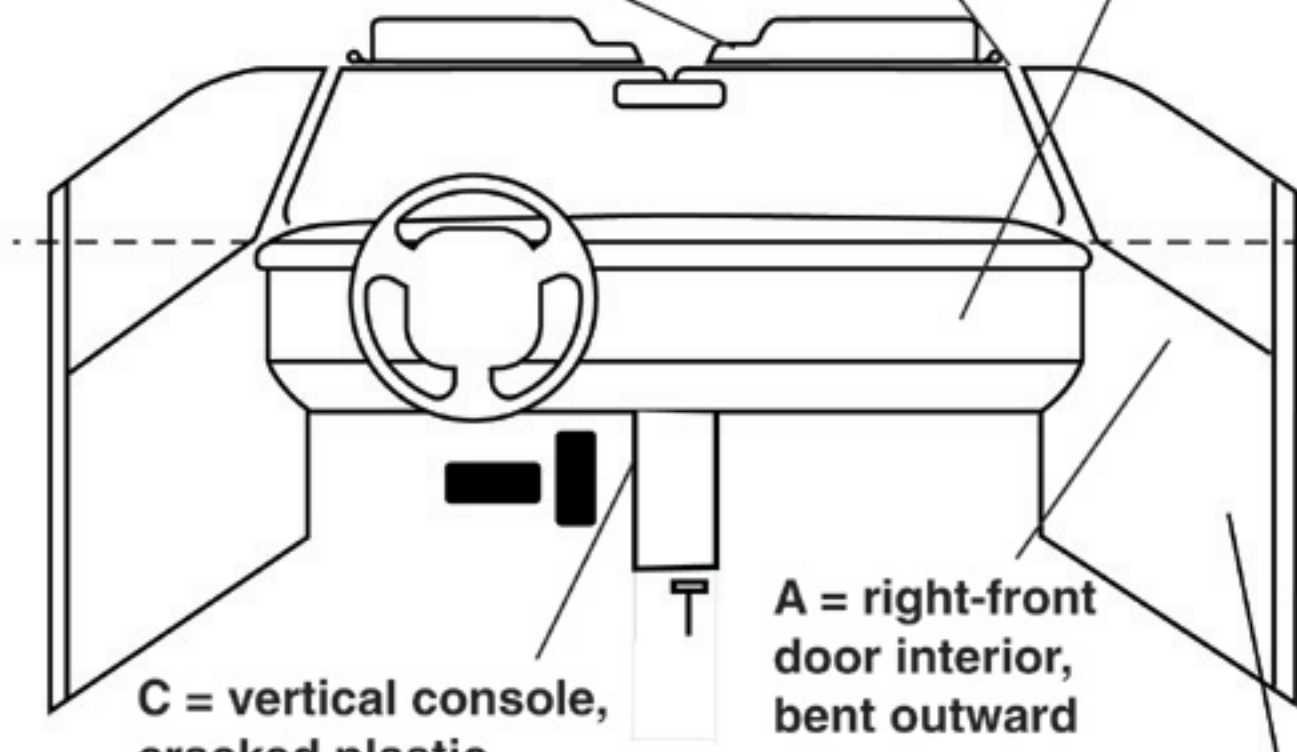


**C = vertical console,
cracked plastic**

**A = right-front
door interior,
bent outward**

**B = right-front door
interior hardware,
broken plastic**


Driver Airbag

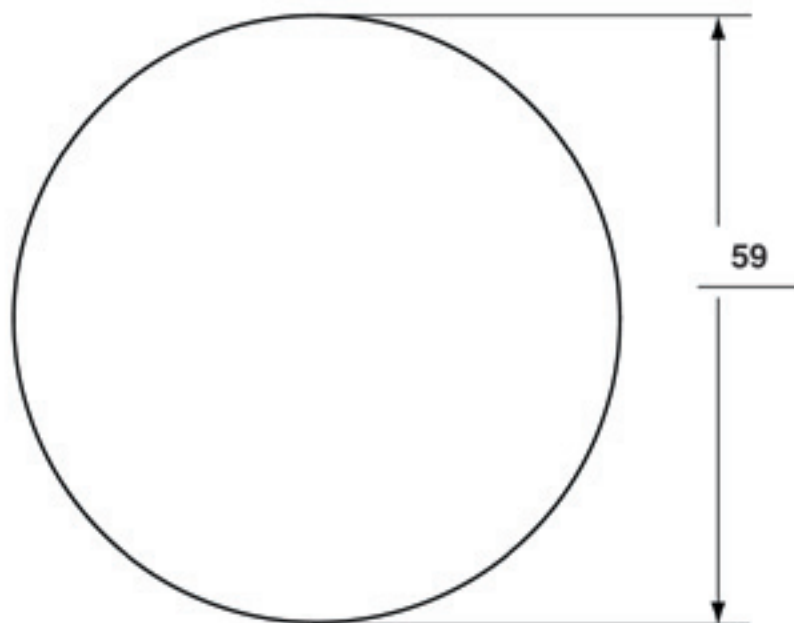


Vents: ☒ Y ☐ N
if yes, how many: 2
at 1 and 11 o'clock

Tethers: ☒ Y ☐ N
if yes, how many: 2


Driver Airbag Doors

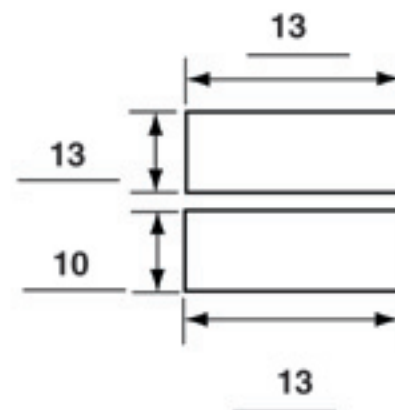

Passenger Airbag

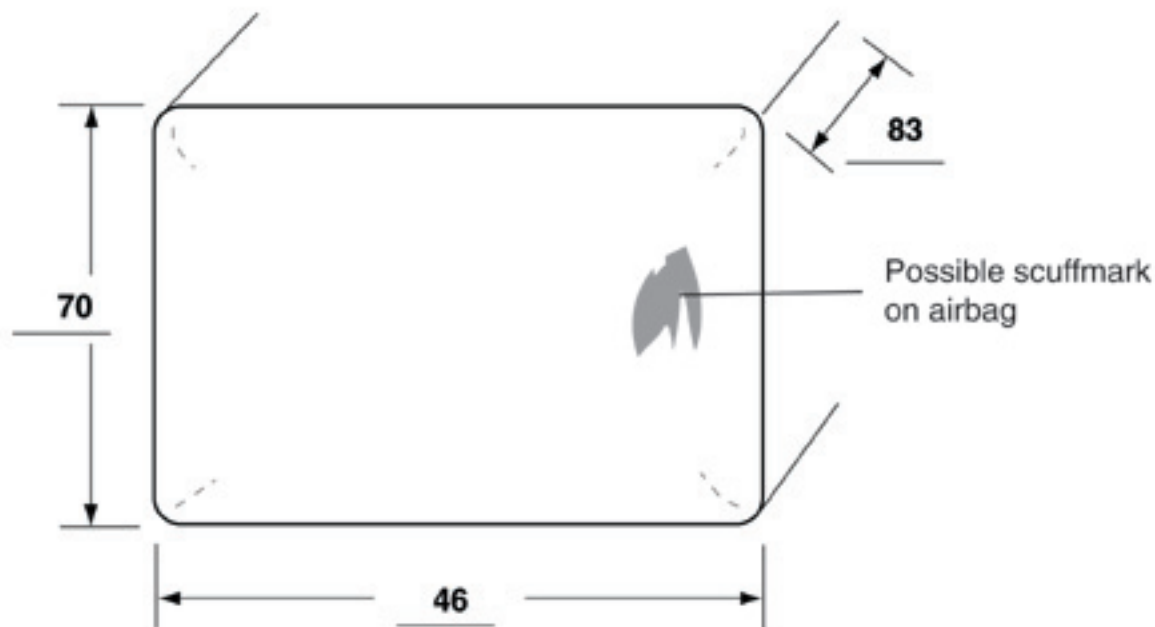

Passenger Airbag Doors

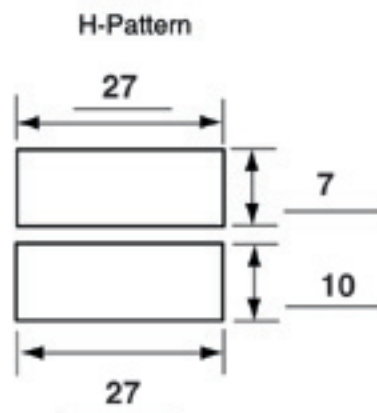

Vents: ☒ Y ☐ N
if yes, how many: 2

at 3 and 9 o'clock on sides

Tethers: Y ☒ N
if yes, how many: _____

Case # 262: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	03	Central	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	CCAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	more
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	1	Left	more
V2005 — Occupant Position -posture	10	Sitting on seat	more
V2006 — Occupant Age In Years	21	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	057 kg	—	—
V2009 — Occupant Height	165 cm	—	—
V2010 — Occupant Sex	2	Female	more
V2011 — Occupant Treatment/Mortality	02	Treated at hospital/clinic but not admitted	more
V2012 — Injury Severity Score	01	ISS 1	more
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	1	C - Possible injury	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more

V2022 — Highest OIC Severity	1	Minor	more
V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	0	None	more
V2025 — Source of Occupant Info	7	Combination of above	more

Case # 262: Occupant # 2; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	26	Roof side rail	more
V2104 — Primary OIC -body Region	08	Head/skull	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	02	Brain	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	HRCB3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	26	Roof side rail	more
V2104 — Primary OIC -body Region	08	Head/skull	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	02	Brain	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	HLCB3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	19	Superior/upper	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FSAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	26	Roof side rail	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FLLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	26	Roof side rail	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	more
V2102 — 1st Prob Contact Area	22	Window glass (side)	more
V2103 — 2nd Prob Contact Area	26	Roof side rail	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FIL11	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	CRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	CRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	01	Arm (upper)	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	ARAI 1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	01	Arm (upper)	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	ARCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	more
V2102 — 1st Prob Contact Area	52	Internal flying glass (from any source)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	RRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #12

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	12	Injury #12	more
V2102 — 1st Prob Contact Area	52	Internal flying glass (from any source)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	RRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #13

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	13	Injury #13	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	23	Wrist/hand	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	WRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #14

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	14	Injury #14	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	02	Back	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	BIFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #15

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	15	Injury #15	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	01	Anterior/front	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	PAFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #16

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	16	Injury #16	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	16	Posterior/back	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	PPFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #17

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	17	Injury #17	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	01	Anterior/front	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	PAFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #18

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	18	Injury #18	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	01	Anterior/front	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	PAFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #19

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	19	Injury #19	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	01	Anterior/front	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	PAFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #20

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	20	Injury #20	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	01	Anterior/front	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	PAFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2; Injury #21

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	21	Injury #21	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	QLAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 262: Occupant # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	02	Occupant #2	more
V2002 — Occupant Role At 1st Impact	2	Motor vehicle passenger	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	5	Right	more
V2005 — Occupant Position -posture	99	Unknown	more
V2006 — Occupant Age In Years	23	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	064 kg	—	—
V2009 — Occupant Height	160 cm	—	—
V2010 — Occupant Sex	2	Female	more
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	more
V2012 — Injury Severity Score	22	—	—
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	3	A - Incapacitating Injury	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	0	None (available but not used)	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more
V2022 — Highest OIC Severity	3	Serious	more

V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	0	None	more
V2025 — Source of Occupant Info	7	Combination of above	more


























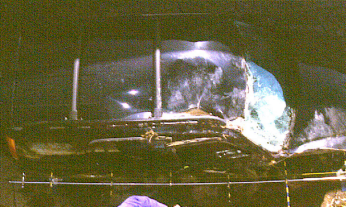





































HONDA
CR-V





























WARNING

DEATH or SERIOUS INJURY can occur

- Children or pets can be caught in the bag.
- The bag can catch fire or melt if it gets too hot.
- The bag can catch fire or melt if it gets too hot.
- The bag can catch fire or melt if it gets too hot.

















SAFETY WARNING



























